

Project Information

Surveyor Name	BUENO_R	Certificate Number	P0043820-082023
Owner		Customer	RIVERBEND OF NAPLES MOBILE HOA
Drainage Area		PO Number	231753
Pipe Segment Reference	MH-1 - MH-4	Date	11/30/2023 18:33
Street	WALKERBILT RD	City	NAPLES
Comments			

Manhole

Upstream MH	1	Rim to Invert (U)	
Grade to Invert (U)		Rim to Grade (U)	
Downstream MH	4	Rim to Invert (D)	
Grade to Invert (D)		Rim to Grade (D)	
Sewer Use	Sanitary	Direction of Survey	Downstream

Pipe

Height (Diameter)	6	Width	
Shape	Circular	Material	Polyvinyl Chloride
Lining Method		Pipe Joint Length	
Total Length		Length Surveyed	26.1
Year Laid		Year Renewed	

Misc

Flow Control	Not Controlled	Media Label	DVD
Purpose	Routine Assessment	Sewer Category	
Pre-Cleaning	Jetting	Date Cleaned	11/30/2023 18:34
Weather	Dry	Location Code	Main Highway - Suburban/Rural
Additional Info		Location Details	

Custom

Number of Taps		Number of Roots	
Num Cracks / Fractures		Number of Broken / Holes / Collapse	
Number of Deposits		Custom6	
Custom7		Struct Grade	
OM Grade		Overall Grade	

Pacp 6

Reverse Setup ID		Sheet (Group) Number	
Imperial Units (US)	True	Pressure Value	
Work Order		Project	RIVERBEND OF NAPLES SANITARY 11.30.2023
		Completed	No

Project: RIVERBEND OF NAPLES SANITARY


11.30.2023

Date: 11/30/2023 6:33:00 PM
Street: WALKERBILT RD
Length Surveyed: 0
Pacp Quick Overall Rating: 2200
Height (Diameter): 6
Street: WALKERBILT RD

Pipe Segment Reference: MH-1 - MH-4
Upstream MH: 1
Downstream MH: 4
Direction of Survey: Downstream
Material: Polyvinyl Chloride

Distance	Fault Observation	Time	Picture
0.0	<p>Manhole Severity: None Remarks: 1</p>	01:01	
0.0	<p>Water Level Severity: None Percent: 5</p>	01:36	
6.1	<p>Tap Factory Position: 12 Severity: None Size: 6</p>	02:36	

Distance	Fault Observation	Time	Picture
22.7	Material Change Severity: None Remarks: VCP	04:13	
25.9	Joint Offset Large Severity: None Remarks: INFIL DRIPPER Struct Weight: 2	05:29	
26.0	Abandoned Survey Severity: None Remarks: CANT MAKE IT PASS JOINT	07:39	

Distance	Fault Observation	Time	Picture
26.1	<p>Joint Separated Large Severity: None Struct Weight: 2</p>	06:05	

Created with the  report generator

Project: RIVERBEND OF NAPLES SANITARY

11.30.2023

Date: 11/30/2023 6:33:00 PM

Street: WALKERBILT RD

Length Surveyed: 0

Pacp Quick Overall Rating: 2200

Height (Diameter): 6

Street: WALKERBILT RD

Pipe Segment Reference: MH-1 - MH-4


Upstream MH: 1

Downstream MH: 4

Direction of Survey: Downstream

Material: Polyvinyl Chloride

Severity
Light
Moderate
Average
Heavy
Severe

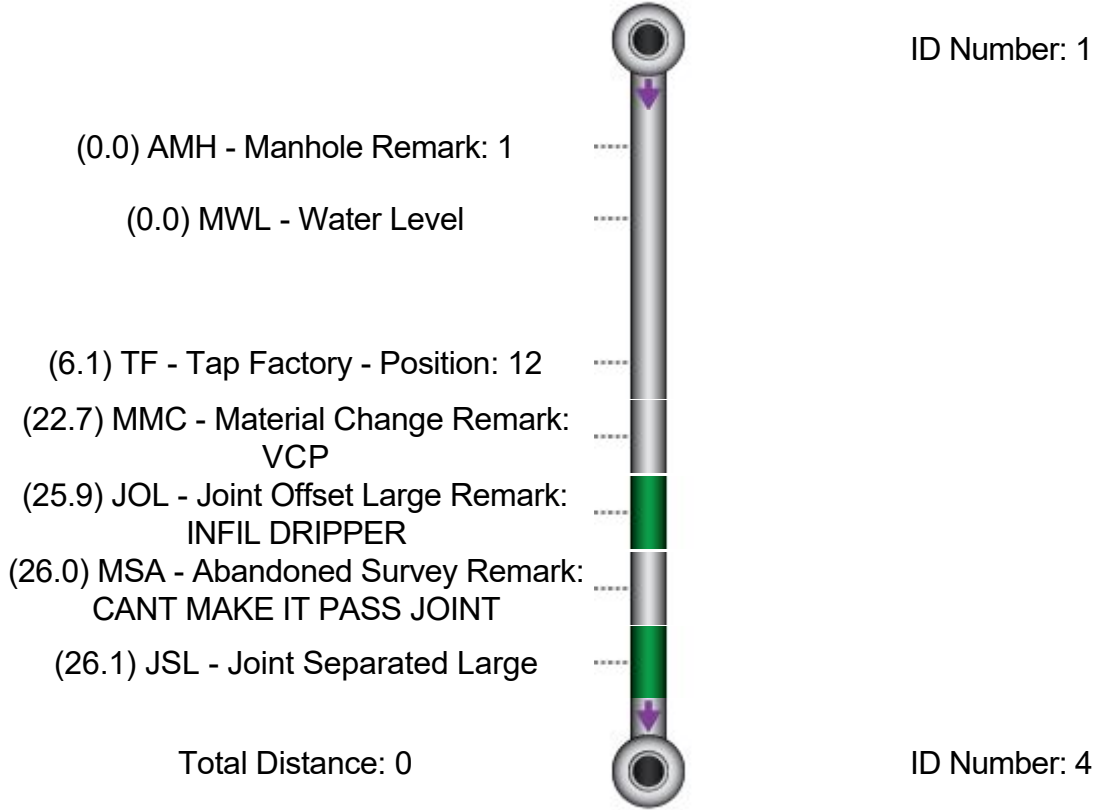

Nassco C.C.T.V. Defect Code Information

Grade	Structural	O&M	Overall
5	0	0	0
4	0	0	0
3	0	0	0
2	4	0	4
1	0	0	0
Overall	4	0	4
Number of Defects	2	0	2
Pipe Rating	2200	0000	2200
Pipe Ratings Index	2	0	2

Nassco C.C.T.V. Defect Code Information

Distance	Video Ref	Code	Cont Defect	Value			Joint	Circumferential Location	
				Dimension		%		At / From	To
				1st	2nd				
0	61	AMH - Manhole							
		1							
0	96	MWL - Water Level			5				
6.1	156	TF - Tap Factory		6			12		
22.7	253	MMC - Material Change							
		VCP							
25.9	329	JOL - Joint Offset Large							
		INFIL DRIPPER							
26	459	MSA - Abandoned Survey							
		CANT MAKE IT PASS JOINT							
26.1	365	JSL - Joint Separated Large							

Created with the  report generator

Videos Created for Session RIVERBEND OF NAPLES SANITARY 11.30.2023

1-4_11302023-1834-D.mp4 Size: 186 MB

Your browser does not support the video tag.

Created with the  report generator

Project: RIVERBEND OF NAPLES SANITARY

11.30.2023

Date: 11/30/2023 6:33:00 PM

Street: WALKERBILT RD

Length Surveyed: 0

Pacp Quick Overall Rating: 2200

Height (Diameter): 6

Street: WALKERBILT RD

Pipe Segment Reference: MH-1 - MH-4

Upstream MH: 1

Downstream MH: 4

Direction of Survey: Downstream

Material: Polyvinyl Chloride

Percent Grade Mean: -6.15

Plot Distance From: 0 To 1


Max Percent Difference: 3

Number of Window Values: 1

Percent Difference Max for Windows Values: 60

Number of Feet to Average: 1

Final number of points plotted: 21

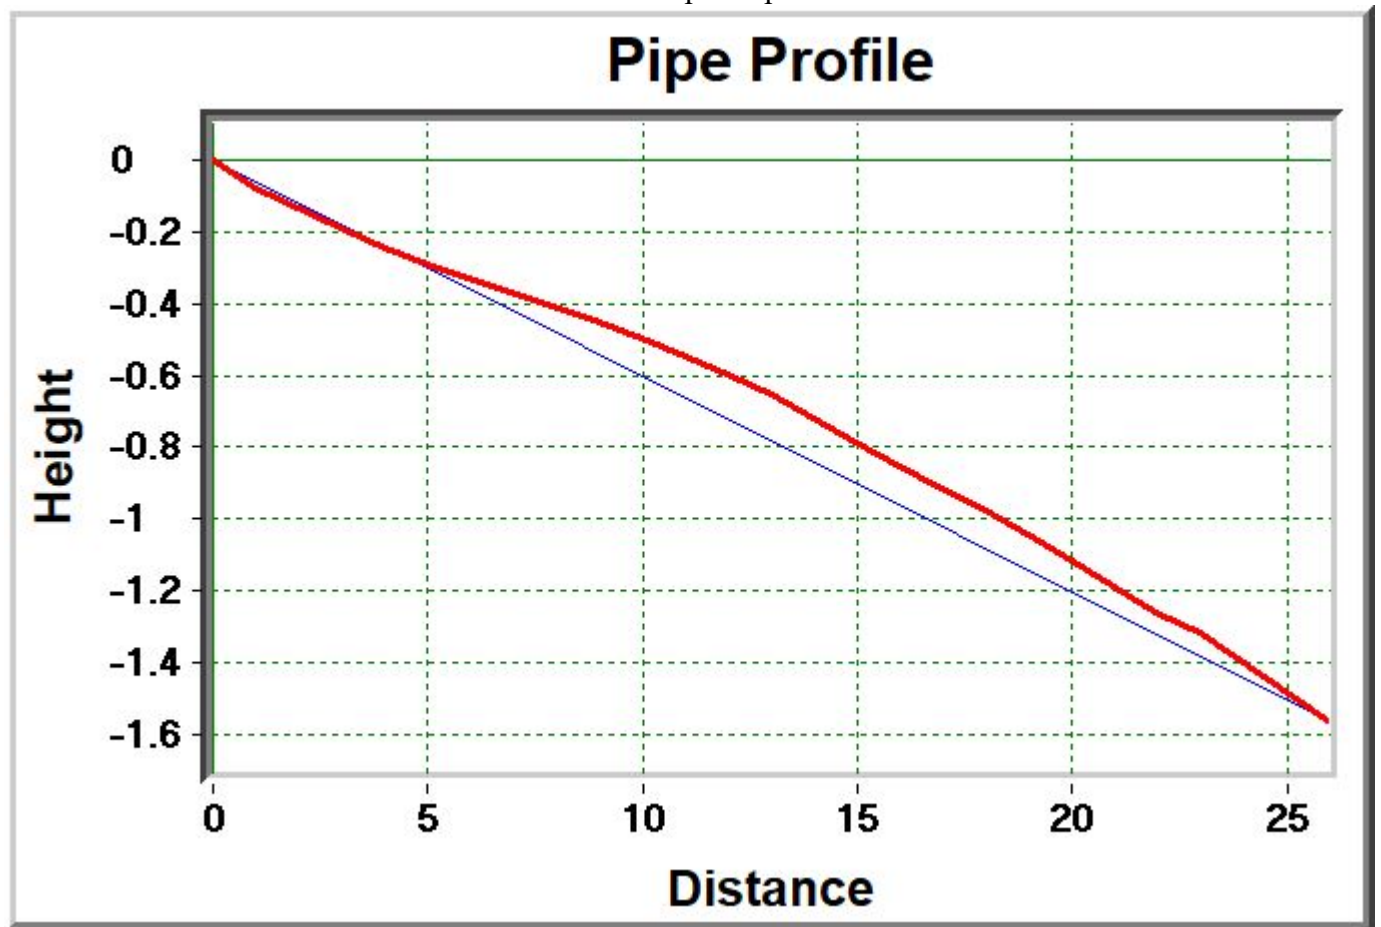

Additional Reports for Session RIVERBEND OF NAPLES SANITARY 11.30.2023

Created with the  report generator

